




Instant Setback Cubby
(for PACE TD-100 Handpieces only)
PACE PART NUMBER 6019-0084-P1
Installation and Maintenance Instructions
MANUAL NUMBER 5050-0561

1. Turn power switch to the OFF position. Allow the TD-100 handpiece to cool before connecting the instant setback cubby.
2. Connect Cubby cable to receptacle located on the rear panel of the power supply.
3. Position the Cubby on workbench within operator reach.
4. Insert TD-100 with tip into Cubby.
5. Turn power switch to the on position.
6. When the TD-100 handpiece is inserted into the Cubby, the system will automatically go into the Setback Mode after 45 seconds of non-use. Once the Handpiece is removed from the Cubby, it will return to normal operation.



WARNING

Keep the Cubby's handpiece holder free of solder debris. Solder build up may prevent system from correctly sensing tip temperature.

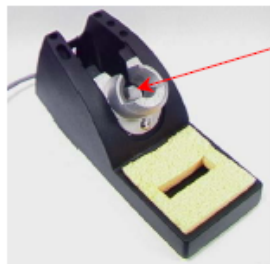

Handpiece holder



PACE Incorporated
255 Air Tool Drive
Southern Pines,
North Carolina, 28387
Tel: (877) 882-PACE
Tel: (910) 695-7223
Fax: (910) 695-1594

Pace Europe
11 Holdom Avenue
Bletchley, Milton Keynes,
United Kingdom, MK11QU
Tel: 011 44 1908 277666
Fax: 011 44 1908 277777

©2013 PACE Incorporated, Southern Pines NC All Rights Reserved. Printed in the USA

www.paceworldwide.com